



Field Installable FlexConnector - FLATdrop

Installation Manual

1. Prep FLATdrop to YOURx length (12"), cutting strength members and cable sheath. If tone wire is present, peel back at least 5" from cable opening and secure to cable.



2. Feed the following length of heat shrink onto cable for later use:

(1) 3/4" x 2" long (004719)



3. Place clips on top and bottom of cable, aligning nose of clips with cable opening.




4. Use pliers (as shown) to pinch teeth to hold jacket. Do **NOT** use needle nose pliers.



5. Pass breakout buffer tube through the FlexConnector.



6. Align latches on clips with windows in the FlexConnector. Insert and push until you hear it snap in to place.

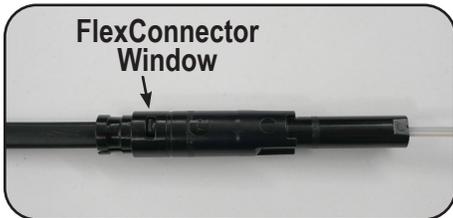

7. Slide the 3/4" heat shrink over the FlexConnector, covering the windows (no further than 1/4" past windows and not past the indented ring) and heat to shrink.



8. Ensure heat shrink covers windows but does not exceed past indented ring around the FlexConnector. If past the ring, trim heat shrink back as necessary.

